

4453 Sycamore Road
Cincinnati, OH 45236
Phone: 513-891-8450 FAX: 513-891-8460

Order Date 04/11/03 08:23 am
Closed/Paid: 04/22/03 05:36 pm

Invoice No.
000003249

	93 PORSCHE 911 Black Mileage in:38401 out:38414 Lic: AMRDSTR/OH 6Cyl 3.6 Eng Vin: WP0CB2963PS460567 09/93 Eq: Last in 4/10/2006
--	---

Non-Turbo

Job01 Oil Service	Labor: \$82.80
--------------------------	-----------------------

SYNTEC20	Sytec 20W50	10.0 @	5.99 =\$	59.90	
72116	Oil Filter	1.0 @	10.86 =\$	10.86	
WASHER SOLVENT	Washer Solvent	1.0 @	1.99 =\$	1.99	72.75

Change oil and filter
Lubricate chassis where applicable
Check all vehicle fluids quantity and quality - add washer fluid.
Inspect windshield wiper operation
Check all lighting operation
Test tire pressure and adjust

Job Subtotal: \$155.55

Job02 Heater	Labor: \$0.00
---------------------	----------------------

runs all of the time. The switch is currently disconnected. Additionally, there seems to be a lot of air coming in with the switch disconnected - like there's a fresh air flap open, no matter what position you put the controls in.

Check heater operation.
Plug in fan and test drive car.
Fan working as it should.
Discuss with customer and advise. Will have to malfunction in order to diagnose problem.
Left fan unplugged.

Job Subtotal: \$0.00

Job03 Drain on battery	Labor: \$800.40
-------------------------------	------------------------

Will be dead definitely inside a week. More like 3 days if it's left to sit, it's dead.

Check battery drawl.
133 mA.
Pull all fuses - draw did not change, draw not on a fused circuit.
Load test battery - poor.
Charge battery, and load test again - battery load tested good.
Unplug heater blower relay - not the draw.

----->---->---->---Continued on the next page--->---->----->----->

4453 Sycamore Road
Cincinnati, OH 45236
Phone: 513-891-8450 FAX: 513-891-8460

Order Date 04/11/03 08:23 am
Closed/Paid: 04/22/03 05:36 pm

Invoice No.
000003249

Job03 Drain on battery

Disconnect power to alternator - not the draw.
Remove main circuit panel and unplug plugs one at a time to isolate draw.
Circuit for alarm is pulling most of battery drain.
Ensure that all doors are closing properly.- yes.
Remove passenger seat to access alarm box.
Test circuits to alarm and parcel shelf doors behind seats.
Parcel shelf compartment door switches triggering alarm.
Inspect switches - they are not in their mounting holes, are plugged into harness, but rucked inside compartment behind driver's seat.
Unplug switches so that ground signal is not sent to alarm box causing draw.
Check draw - down to 38 mA.
Replace seat.
Note: Parcel shelf compartment doors do not close very well, so switches are left unplugged.

Job Subtotal: \$800.40

Job04 Emergency brake **Labor: \$69.00**

Needs adjusted - have to pull to full extent of travel in order to get it to work.

Remove rear wheels and adjust park brake shoes.
Reinstall wheels and hand torque to manufactures specification.
Check park brake operation - good.

Job Subtotal: \$69.00

Job05 Tire **Labor: \$41.40**

Right front tire has a slow leak.

Remove right from tire.
Tire had nail in it.
Have nail removed and hole patched.
Install wheel and hand torque to manufactures specification.

Job Subtotal: \$41.40

Job06 Horns **Labor: \$82.80**

has after market horns on there that were put on about a year ago, but they are again "anemic". Needs something stronger.

Check horns - sound loud, but muffled. The air horns are located in right front wheel arch where factory ones are mounted.
Remove right front wheel arch.
Horns working, and are very very loud with wheel arch removed.

----->---->---->---Continued on the next page--->---->----->----->

4453 Sycamore Road
Cincinnati, OH 45236
Phone: 513-891-8450 FAX: 513-891-8460

Order Date 04/11/03 08:23 am
Closed/Paid: 04/22/03 05:36 pm

Invoice No.
000003249

Job06 Horns

Lubricate compressor and check for air leaks - okay.
Reinstall wheel arch.

Job Subtotal: \$82.80

Job07 Interior Light Labor: \$0.00

Interior light stays on.
Time did not permit addressing this issue now.

Job Subtotal: \$0.00

Payments to European Auto Specialists LTD Cost Summary

Status: Closed Work Order
Payments: \$1,254.63
1 04/22/03 1254.63 MCard

Labor	1076.40
Parts	72.75
Shop Supplies	34.47
Tax	71.01
Total	\$1254.63
Payments	1254.63
Bal Due	0.00

Thank you for choosing European Auto Specialists LTD

4453 Sycamore Road
 Cincinnati, OH 45236
 Phone: 513-891-8450 FAX: 513-891-8460

Order Date 04/10/06 08:41 am
 Closed/Paid: 04/15/06 11:47 am

Invoice No.
 000006223

	93 PORSCHE 911 Black Mileage in:45142 out:45152 Lic: AMRDSTR/OH 6Cyl 3.6 Eng Vin: WP0CB2963PS460567 09/93 Eq: Last in 4/10/2006
--	---

Non-Turbo

Job01 Replace Clutch	Labor: \$848.90
-----------------------------	------------------------

999 510 015 02	Sckt Screw 8x4	1.0 @	4.97 =\$	4.97	4.97
----------------	----------------	-------	----------	------	------

Remove and replace owner supplied clutch kit.

Job Subtotal: \$853.87

Job02 Oil Service/Synthetic Oil	Labor: \$101.87
--	------------------------

WASHER SOLVENT	Washer Solvent	0.5 @	3.24 =\$	1.62	
72116	Oil Filter	1.0 @	11.80 =\$	11.80	
20W50 SYNTEC	20w50 Syntec	11.0 @	10.85 =\$	119.35	132.77

Change oil and filter
 Lubricate chassis where applicable
 Check all vehicle fluids quantity and quality
 Inspect windshield wiper operation
 Check all lighting operation
 Test tire pressure and adjust

Job Subtotal: \$234.64

Job03 List	Labor: \$254.67
-------------------	------------------------

765-2661	Dye Oil	2.0 @	8.67 =\$	17.34	17.34
----------	---------	-------	----------	-------	-------

- 1) Oil leak on right side of engine. Seepage from area of right lower cam cover/oil return hoses. Clean off & test drive. No new seepage appeared. Added dye to engine oil. Customer to bring in for reinspection when bulb for dash comes in.
- 2) Interior light won't work with door. Tied to aftermarket alarm. Not related to light or door switches. Will take whatever diagnostic time it takes to trace circuitry and find fault.
- 3) Air bag light on. Requires Porsche diagnostic equipment to access codes, diagnose and clear.
- 4) Light in LCD speed gauge intermitently goes out. Orderd bulb.

Job Subtotal: \$272.01

Recommendations: *Oil Service*

----->---->---->---Continued on the next page--->---->----->----->

European Auto Specialists LTD
4453 Sycamore Road
Cincinnati, OH 45236
Phone: 513-891-8450 FAX: 513-891-8460

Order Date 04/10/06 08:41 am
Closed/Paid: 04/15/06 11:47 am

Invoice No.
000006223

Recommendations

Payments to European Auto Specialists LTD	Cost Summary
---	--------------

Status: Closed Work Order
Payments: \$1,491.55
1 04/15/06 1491.55 Visa

Labor	1205.44
Parts	155.08
Shop Supplies	40.00
Tax	91.03
Total	\$1491.55
Payments	1491.55
Bal Due	0.00

Thank you for choosing European Auto Specialists LTD