

INVOICE

Work Completed : 07/28/2021

Date: 07/29/2021

LBI Limited - Reade Etherington
 4500 Worth St
 Philadelphia, PA 19124
 Cellular 610-357-5095

1988 Porsche - 944 Turbo - 2.5L, In-Line4 (151CI) VIN(A)
 Lic # : Odometer In : 52964
 Odometer Out : 52964
 VIN # : WP0AA095X JN165073

Part Description	Qty	Sale	Ext	Labor Description	Ext
Dot4 brake fluid	3.00	5.50	16.50	Brakes L/F 7 R/F 7 L/R 10 R/R 10 Tires L/F 2 R/F 2	
Brake Clean	2.00	4.79	9.58	L/R 2 R/R 2	
Interior Rear View Mirro	1.00	209.75	209.75	DOT-4Brake Flush	121.47
Window Wiper Blade-Front 19"	2.00	22.86	45.72	Oil Service, Change oil and filter, Reset service light,	67.49
Oil Filter Spin-On	1.00	23.80	23.80	Check brakes and suspension, Check tires and set	
Motor Oil 5W-40 Leichlauf HT - 1L	7.00	14.76	103.32	pressure, check all driving lights, top up fluids	
Wheel Bearing-Rear	1.00	127.50	127.50	NOTE:	
Crush washer	1.00	1.00	1.00	Track tires are from 2019 and most likely hard as a rock	
Mobil 1 Gear Oil 75/90	3.00	17.65	52.95	Brakes L/F 7 R/F 7 L/R 10 R/R 10 Tires L/F 3 R/F 3	
Brake line fitting	1.00	11.25	11.25	L/R 3 R/R 3	
Drivers side window glass (used with shipping)	1.00	225.00	225.00	WHEEL BEARING - Remove & Replace - Rear,One	527.73
Weather strip for lower door track	1.00	92.55	92.55	Side - [Includes: Replace Inner and/or Outer Bearings,	
Lower window channel	1.00	89.78	89.78	Cups, Seals and repack (where applicable).]	
Window seal	1.00	202.47	202.47	Free up frozen wiper motor	107.98
Shop Supplies			87.38	Change gearbox oil	94.48
				Fix leaking brake hard line at L/R union (reflare fitting)	134.97
				Replace L/R brake light bulb	n/c
				Replace broken L/F window	337.43
				NOTE:	
				the drivers side door is missing the window channel /	
				we must order the channel and seals	
				The window is in with a temp window track fix	
				Replace missing steering wheel hardware and torque	67.49
				fasteners	
				Misc time to tidy up wiring and loose hoses.	134.97
				Adjust and secure rear bumper	67.49
				Shipping from Germaney	40.00
				[Recommendations]	
				SERVICE NOTES:	
				The turbo shaft seal is leaking, it may be residual oil from sitting	
				or it may be a active turbine oil shaft seal problem	
				Some oil leaks from the timing cover area	
				Slight oil pan leaks as well	
				There are many more items needed to make this car street	
				worthy. Customer just wanted to do the above repairs at this time.	

Performance Automotive Inc.
 3239 Phoenixville Pk.
 Malvern, PA. 19355
 Phone: 610-695-9545 Fax: 610-695-9098

INVOICE

12606

Org. Est. # 026738

INVOICE

Work Completed : 07/28/2021

Date: 07/29/2021

LBI Limited - Reade Etherington

4500 Worth St
 Philadelphia, PA 19124
 Cellular 610-357-5095

1988 Porsche - 944 Turbo - 2.5L, In-Line4 (151CI) VIN(A)

Lic # :

Odometer In : 52964

Odometer Out : 52964

VIN # : WP0AA095X JN165073

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Labor:	1,661.50
Parts:	1,298.55
Sublet:	40.00
Sub:	3,000.05
Tax:	180.00
Total:	\$3,180.05
Bal Due:	\$3,180.05

Vehicle Received: 7/28/2021

Customer Number : 5042

Signature _____ Date _____